

# 2020 - 2021 Cadillac CT5-V: Service Bulletin: #PIP5763: Service Rear Axle Message with DTC C1135 SYM92 - (Nov 13, 2020)

## #PIP5763: Service Rear Axle Message with DTC C1135 SYM92 - (Nov 13, 2020)

**Subject:** Service Rear Axle Message with DTC  
C1135 SYM92

| Brand:   | Model: | Model Year: | VIN:    | Engine: | Transmission: |
|----------|--------|-------------|---------|---------|---------------|
|          |        | from to     | from to |         |               |
| Cadillac | CT5-V  | 2020 - 2021 | ALL ALL | LGY     | MHS           |

***Involved Region or Country*** North America

***Additional Options (RPO)*** RPO G96 Differential, Electronic Limited Slip

***Condition*** Some customers may comment that there is a Service Axle message displayed and possible loss of limited slip differential function.

***Cause*** This condition occurs when C1135 symptom byte 92 is set in the K164 Differential Control Module (DCM)

### **Correction**

Engineering has identified a software anomaly that causes the DTC to set prematurely. If code C1135.92 is in History, clear codes using GDS2 and take no further action. Do not replace the K164

## Differential Control Module.

A revised calibration will be available in the December 2020 timeframe to address this condition.

A Bulletin will be released to replace this PI when the calibration is available

**Note:** If the DTC is Current, continue with published Service Information diagnostics.

|                 |                          |
|-----------------|--------------------------|
| <i>Version</i>  | 1                        |
| <i>Modified</i> | 11-13-2020 – Created on. |

Online URL:

<https://www.cadillacvnet.com/knowledge-base/article/2020-2021-cadillac-ct5-v-service-bulletin-pip5763-service-rear-axle-message-with-dtc-c1135-sym92-nov-13-2020-43.html>