


2016 - 2018 Cadillac ATS-V CTS-V: Service Bulletin: #16-NA-059: Staining/Discoloring to Brake Caliper Paint - (Oct 14, 2020)

#16-NA-059: Staining/Discoloring to Brake Caliper Paint - (Oct 14, 2020)

Subject:				Staining/Discoloring to Brake Caliper Paint			
Brand:	Model:	Model Year:		VIN:		Engine:	Transmi
		from	to	from	to		ssion:
Cadillac	ATS-V	2016	2018	—		All	All
	CTS-V	2016	2018				
Chevrolet	Camaro	2012	2021				
	Corvette	2014	2020				

<i>Involved Region or Country</i>	North America, Europe, Russia, Middle East, Israel, Argentina, Brazil, Bolivia, Chile, Colombia, Ecuador, Paraguay, Peru, Uruguay, Japan, GM Korea Company, China, Taiwan, Philippines
-----------------------------------	--

Condition

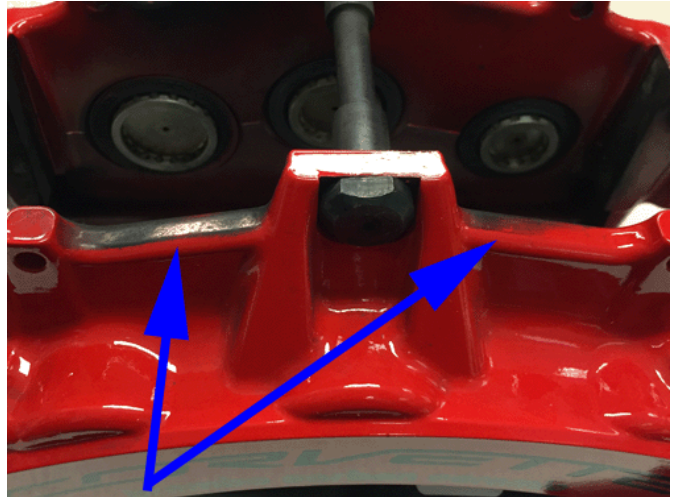

Cause


Some customers may comment on a discoloration or black stain on the paint of the brake calipers.

This may be caused by high brake pad temperatures during aggressive driving or track event tarnishing the caliper paint.

Correction

Important: Do *NOT* replace the brake calipers for this condition.

This is not a defect in the paint or the caliper.

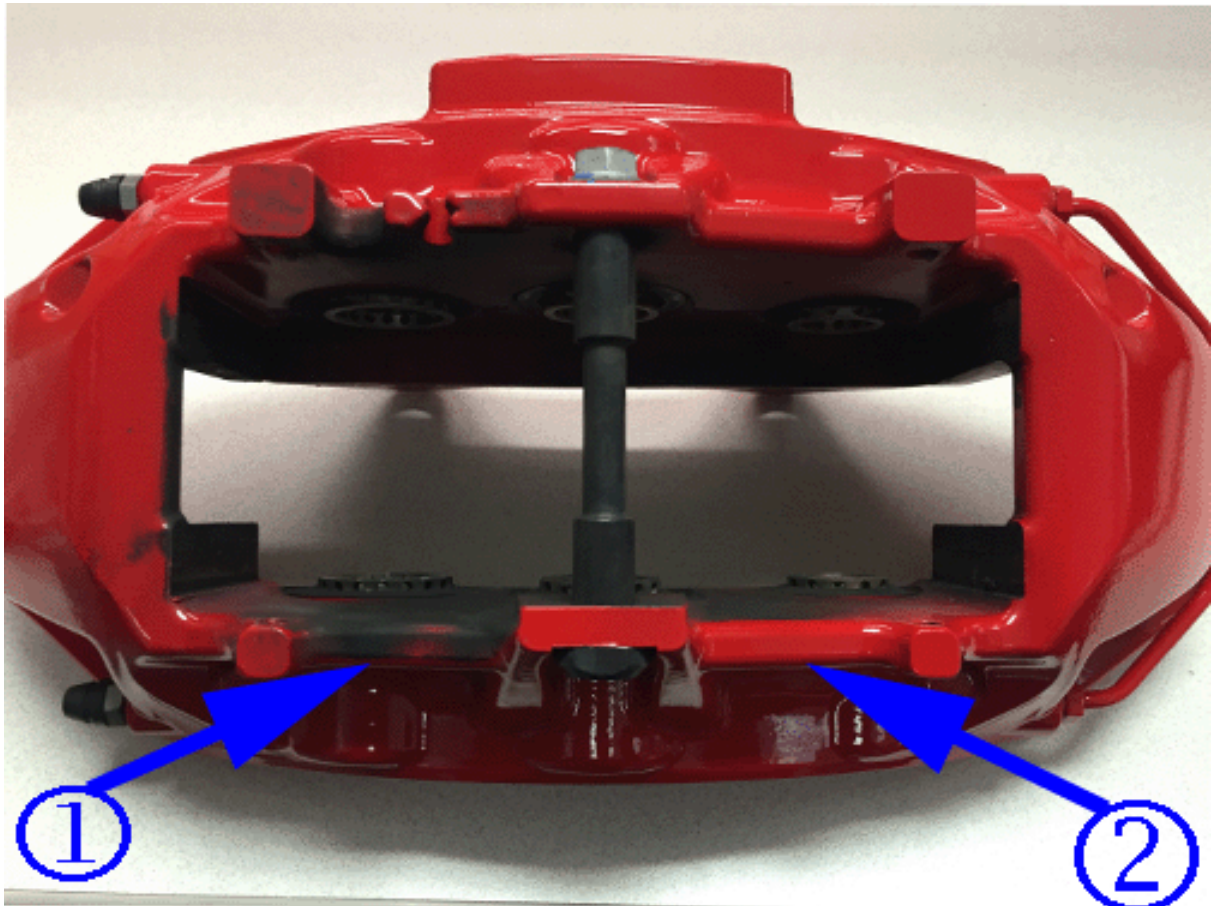

- | | |
|-----|---|
| (1) | Not cleaned using mild polishing compound |
| (2) | Cleaned using mild polishing compound |

If the customer wishes to have the black stain removed, a very mild polishing compound can be used to remove the stain.

Important: Do NOT use harsh chemicals or brake cleaner to attempt

to remove the stain. This could damage the paint on the caliper.

Version

3

Modified

May 30, 2017 – Updated the Models and Model Years.

October 14, 2020 – Updated the Models, Model Years and updated formatting to remove Attention statement and add the Involved Region or Country section.

Online URL:

<https://www.cadillacvnet.com/knowledge-base/article/2016-2018-cadillac-ats-v-cts-v-service-bulletin-16-na-059-staining-discoloring-to-brake-caliper-paint-oct-14-2020-39.html>